

Document class Release Note
Document ID 1MRS758931
Business Unit ABB Oy, Distribution Solutions
Page 1/4
Date 19.1.2018

Firmware update release 4.0.6 for 615 series IEC product version XE protection relays

Scope

Firmware update release 4.0.6 is for the following 615 series protection relays:

- § REF615
- § REM615
- § RET615
- § REU615
- § RED615

To verify that the firmware update applies to the protection relay version, ensure that the second and last two characters of the order code on the label on top of the human-machine interface (HMI) match the corresponding characters of the order code in Fig. 1.

xBXXXXXXXXXXXXXXXXXE
 ↑ ↑↑

Fig 1. Order code of the 615 series protection relays

To identify the current firmware (SW) revision of the 615 series protection relay, please refer to Fig. 2.

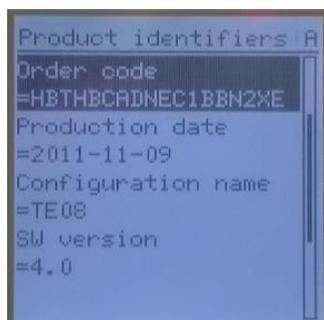


Fig. 2 Current firmware revision of the 615 series protection relay

Implemented usability improvements

The firmware update release includes usability improvements, but introduces no new functionality. The following improvements have been implemented:¹

Firmware update release 4.0.6:

Control

- § Improvement to the synchrocheck function for preventing unexpected short-period reset of SYNC_OK output. The reset could have been seen in vector shift situations earlier.
- § Improvement to the synchrocheck function for preventing unexpected short-period reset of SYNC_OK output. The reset could have been seen in very rare situations earlier even when the synchronism conditions were fulfilled and voltages were aligned on both sides of the breaker.

Firmware update release 4.0.5:

Control

- § Manual control of function block OLATCC1 is now enabled for "Operator" user of the relay.

HMI

- § Enhanced programmable LED response for ensuring update of the programmable LEDs on the LHMI during open/close command.
- § The Local HMI object control selection behavior improved while user log in and log out.

Measurement

- § The updating of the minimum demand value calculation is improved for function block PEMMXU when the measurement is under minimum power limit.
- § Unnecessary warning is not any more generated by the self-supervision of the RTD measurements in REM615 motor protection relay.

Communication

- § The relay is able to start up normally even if vertical communication data sets are empty or not available at all.
- § ARP table size increased to hold more client IPs.

¹ The relay firmware update may also include some minor usability improvements not listed in this note.

Date	19.1.2018
Page	3/4
Subject	Firmware update release

IEC 61850:

- § Improved GOOSE sending performance at high application load, e.g. when using complex configurations.
- § The performance enhancement for system communication (MMS) event sending during extremely high event load situations.

IEC 103:

- § Improvement in Rated primary value (RPV) and rated secondary value (RSV) of the IEC 103 for preventing that the U0 value is constantly zero in IEC 103 disturbance recording.
- § Improvement in the time stamp of the disturbance recording for preventing that minutes in the IEC 103 disturbance record might occasionally be incorrect
- § The transmission handling of the disturbance recorder has been improved for IEC 103 protocol when uploading with very fast reading cycles.
- § CRC check sum calculation improved for retransmitted variable-length messages with certain masters in IEC 103 protocol.

Modbus:

- § Improved refreshing logic of current measurement value for Modbus protocol.

DNP 3.0:

- § The DNP3.0 Rx buffering has been improved to prevent a situation where the DNP3.0 response sequence numbers are occasionally lagging behind the requested sequence numbers.

Supervision

- § Audit trail handling is improved during restart situation.
- § Self-supervision coverage of the RAM memory has been improved.
- § Improved failure tolerance of the file system for preventing a possible file opening failure, resulting "CRC error" indication on the Local HMI, after restarting of the relay.
- § Self-supervision improved to prevent the unnecessary error message "57 Light sensor error" when ARCSARC functionality is not supported.
- § The internal diagnostic logging of the line differential communication in RED615 relay has been enhanced.

Date	19.1.2018
Page	4/4
Subject	Firmware update release

Update procedure

Firmware updates represent an integral part of ABB's life cycle management of distribution protection and control relays. The updates ensure optimized usability throughout the relay's entire life cycle by offering the latest improvements. The ideal time for a firmware update would be during periodical testing or a maintenance break.

All 615 series IEC version 4.0 (XE) product deliveries dispatched later than January 17, 2018 include the stated relay firmware update 4.0.6.

Please note that ABB will not be liable for any direct or indirect costs related to the firmware update procedure. The update procedure shall be performed at the sole responsibility of the possessor of the installed base.