


# FurseWELD

## Bar to steel surface BS1 & BS2

### Bar to steel surface BS1 - FurseWELD

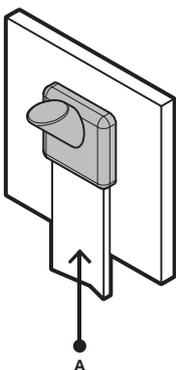

The diagram shows a cross-section of a flat tape conductor being inserted into a mould. An arrow labeled 'A' indicates the direction of insertion.

Flat tape conductor size A (mm)	Mould part no.	Order code	Powder cartridge part no.	Handle clamp part no.
25 x 3	BS1-4-253	7TCA083910R0573	90P10	HCPK4
25 x 4	BS1-4-254	7TCA083910R0575	90P10	HCPK4
25 x 6	BS1-4-256	7TCA083910R0576	150P10	HCPK4
30 x 3	BS1-4-303	7TCA083910R0579	90P10	HCPK4
30 x 4	BS1-4-304	7TCA083910R2919	115P10	HCPK4
30 x 5	BS1-4-305	7TCA083910R2920	150P10	HCPK4
38 x 6	BS1-4-386	7TCA083910R0581	250P10	HCPK4
40 x 3	BS1-4-403	7TCA083910R0582	150P10	HCPK4
40 x 4	BS1-4-404	7TCA083910R0583	200P10	HCPK4
40 x 5	BS1-4-405	7TCA083910R2921	200P10	HCPK4
50 x 3	BS1-4-503	7TCA083910R0584	200P10	HCPK4
50 x 4	BS1-4-504	7TCA083910R0585	250P10	HCPK4
50 x 6	BS1-5-506	7TCA083910R0586	2 x 150P10	HCPK5


Special moulds for all FurseWELD products can be manufactured to meet specific customer applications on request

For order codes of powder cartridges and handle clamps, see pages 49-50

FurseWELD moulds should only be used with FurseWELD powders, handle clamps and accessories. If moulds, powders, handle clamps and accessories from other manufacturers are utilized, we cannot guarantee the safe use or the integrity of the completed joint

Conductors must be installed in the orientation shown to achieve the correct connection

### Bar to steel surface BS2 - FurseWELD

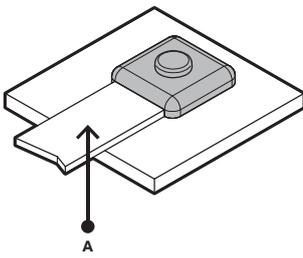

The diagram shows a cross-section of a flat tape conductor being inserted into a mould. An arrow labeled 'A' indicates the direction of insertion.

Flat tape conductor size A (mm)	Mould part no.	Order code	Powder cartridge part no.	Handle clamp part no.
25 x 3	BS2-4-253	7TCA083910R0591	90P10	HCPK4
25 x 4	BS2-4-254	7TCA083910R0592	90P10	HCPK4
25 x 6	BS2-4-256	7TCA083910R0593	150P10	HCPK4
30 x 3	BS2-4-303	7TCA083910R2922	115P10	HCPK4
30 x 4	BS2-4-304	7TCA083910R2923	150P10	HCPK4
30 x 5	BS2-4-305	7TCA083910R2581	200P10	HCPK4
38 x 6	BS2-4-386	7TCA083910R0595	200P10	HCPK4
40 x 3	BS2-4-403	7TCA083910R2617	200P10	HCPK4
40 x 4	BS2-4-404	7TCA083910R0596	200P10	HCPK4
40 x 5	BS2-4-405	7TCA083910R0597	200P10	HCPK4
50 x 3	BS2-4-503	7TCA083910R0598	200P10	HCPK4
50 x 4	BS2-5-504	7TCA083910R0599	2 x 150P10	HCPK5
50 x 6	BS2-5-506	7TCA083910R0600	2 x 150P10	HCPK5

Special moulds for all FurseWELD products can be manufactured to meet specific customer applications on request

For order codes of powder cartridges and handle clamps, see pages 49-50

FurseWELD moulds should only be used with FurseWELD powders, handle clamps and accessories. If moulds, powders, handle clamps and accessories from other manufacturers are utilized, we cannot guarantee the safe use or the integrity of the completed joint

Conductors must be installed in the orientation shown to achieve the correct connection